


Tools and Materials Needed

1. Replacement Stainless Steel Hook Assembly (#109662), includes:
 - Hook (#102665)
 - 3/8" Heat Shrink (#100878)
 - 1/4" Heat Shrink (#104115)
 - 3 x 1/6" Crimps (1 as spare) (#106365)
2. Hot Air Gun
3. Vice

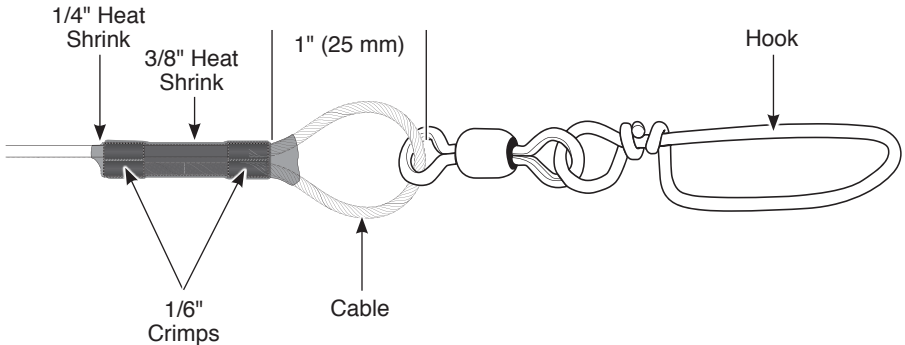

Instructions

1. Slide both pieces of heat shrink over the end of the cable and out of the way.
2. Slide two crimps over the cable end.
3. Loop the cable through the eye in the hook and bring the cable end back onto itself.
4. Thread the cable end through each of the crimps. The crimps should be about 3/4" (20 mm) apart, with the first crimp covering the end of the cable. The loop created in the cable should not be longer than 1" (25 mm). See diagram.
5. Place each crimp individually into a vise and tighten the vice to capture the cables. Flattening of the cable should be visible when adequate pressure has been applied.
6. Slide the 1/4" heat shrink down the cable and center it over both crimps. Use a hot air gun to shrink the heat shrink over the cable. Repeat this process with the 3/8" heat shrink, centered over the previously installed 1/4" heat shrink.

®Solinst is a registered trademark of Solinst Canada Ltd.